

No. C. 4A

ENGINE  
FUEL SYSTEM

April, 1962  
No. 62/3

GASOLINE FILLER CAP  
HILLMAN SUPER MINX

If you should have a case of water entry into the gasoline tank you are recommended to carry out the following procedure until a modification is in production.

- a) Remove existing gasoline filler lid cap from assembly, open up existing breather hole from 1/32" to 3/32", discarding breather pad Part No. 1208604 and retaining spring 1214347.
- b) Obtain a new cap Part No. 2212698 soldering up the existing 1/32" breather, and give good covering with an anti-corrosion paint.
- c) Assemble unit with new solid cap sandwiched between the spring and original cap with seal.