

PARTS
ROOTES
SERVICE

SERVICE BULLETIN

MISC
PROC.

No. 63/17

OCTOBER, 1963

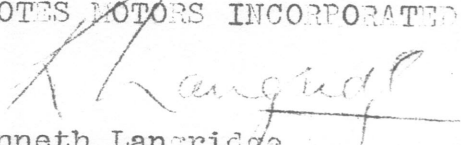
TO: ALL ROOTES DEALERS
SUBJECT: NOISY REAR SHOCK ABSORBERS
MODEL: HILLMAN SUPER HINK

When dealing with complaints of noisy rear shock absorbers, you are advised to remove these from the vehicle and to check the lengths of the upper and lower mounting pins over which the shock absorber eye rubbers fit.

The effective length of these pins must be 1.3" (33 mm) minimum and if they are found to be less than this, washers, Part No. 9067025 must be fitted to bring the effective length up to 1.3 / 1.33" (33 - 33.8 mm).

When re-assembling the shock absorbers to the vehicle, the mounting pins and the boxes of shock absorber eyes should be well lubricated.

ROOTES MOTORS INCORPORATED


Kenneth Langridge
General Service Manager

KL/jd