

ENGINE

No. B-10

PAGE 1 OF 2

SEPT. 1965

TO: ALL ROOTES GROUP DEALERS

MODEL: SUNBEAM IMP

SUBJECT: ENGINE OIL FILTER FELT SEALING RINGS.

Further to Bulletin B-5 issued in July 1964, we would remind you how extremely important it is to check that the felt washer, 'A' on illustration, is correctly positioned and not damaged when replacing the oil filter element.

In order to overcome damage to the felt washer, a small circlip 'E' is now fitted to the centre stud 'C', so preventing the filter element support plate 'B' attaching itself to the element on withdrawal.

Filters fitted with a circlip on Production can be identified by a change in colour of the canister which is now light blue.

When replacing the oil filter element on units prior to the introduction of the circlip, great care should be taken to ensure that all the components shown on the attached illustration are in good condition and fitted in the correct order.

In the near future, all replacement oil filter element packs supplied by Rootes Motors (Parts), Limited will contain a spare circlip, which should be fitted to those units not already incorporating one; a leaflet is included in the box instructing that this action is taken.

Additional circlips, Part No. 7080251, are available through the normal Parts channels.

Please advise your Parts Manager of this information

See: Illustration No. 8210.

KL/of

ROOTES MOTORS INCORPORATED  
*K. Langridge*  
Kenneth Langridge  
General Service Manager

SERVICE BULLETIN B-10

ENGINE OIL FILTER FELT SEALING RINGS

PAGE 2 OF 2

