

ENGINE  
ELECTRICAL  
SYSTEM

No. B-5

PAGE 1 OF 11

JULY-1964

TO: ALL ROOTES GROUP DEALERS  
MODEL: SUNBEAM IMP  
SUBJECT: OIL FILTER

We wish to bring to your attention the necessity to ensure that the felt washer 'A' shown on the attached illustration is not damaged when the filter element is removed.

When replacing the element, ensure that this washer is not trapped between the element support plate 'B' and the center stud 'C'. If the support plate is omitted or the felt damaged, particles can be carried by the lubricating oil round the engine and result in complete loss of the oil pressure and subsequent engine damage.

When changing the oil filter element, therefore, it is vital to ensure that:-

- (1) The felt washer is in good condition.
- (2) It is not damaged while fitting the replacement element.
- (3) The support plate and steel washer 'D' are correctly positioned.

ROOTES MOTORS INCORPORATED

*K. Langridge*  
Kenneth Langridge  
General Service Manager

jd  
Enc. - Sketch 7584

MODEL - SUNBEAM IMP  
SUBJECT - OIL FILTERS

B-5  
JULY-1964

