

TIGER

No.

ISSUE 3 - JANUARY, 1965

SUBJECT - INEFFICIENT HEATER

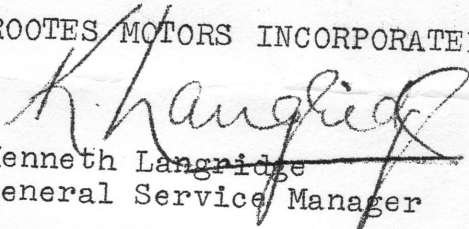
A limited number of complaints have been received regarding poor heating on the Sunbeam Tiger. In the event of this complaint being received, the following alteration in heater pipe line run should be made.

Remove temperature transmitter housing and re-connect as follows:-

Hose from inlet manifold to large diameter connection at front of transmitter housing. The hose from the other large diameter hole in housing will go direct to heater valve. The small diameter pipe should then go from the 'T' piece of the transmitter housing direct to base of carburetor. Drill out water pump heater outlet elbow from 3/16" to 3/8" to increase water flow.

Will addressees please bring this to the attention of Service personnel.

ROOTES MOTORS INCORPORATED


Kenneth Langridge
General Service Manager

KL/jd