

ELECTRICAL
SYSTEM.

No. N-9

SEPT. 1965

TO: ALL ROOTES GROUP DEALERS
MODEL: SUNBEAM IMP
SUBJECT: INTERIOR LIGHT.

A number of cases of intermittent operation of the interior lamp have been reported, which have been due to ineffective earthing of the lamp unit.

This complaint can be effectively overcome by fitting a Number 8 shakeproof countersunk washer, Part No. 9666113, under the head of the left hand fixing screw in the lamp unit.

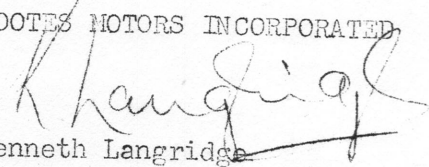
This washer has been fitted in production from the following Chassis Numbers :-

Imp de Luxe. B.419096984.

Imp Basic. B.429003921.

Please inform your Parts Manager of this information.

ROOTES MOTORS INCORPORATED


Kenneth Langridge
General Service Manager

KL/of