

PARTS
ROOTES
SERVICE

4-Me 8
SERVICE BULLETIN

AUTOMATIC
TRANSMISSION

No.
210

December 5, 1960

TO ALL ROOTES GROUP DEALERS

POSSIBILITY OF CHOKE CABLE FOULING THE THROTTLE
OPERATING SHAFT LEVER - SERIES IIIB 'EASIDRIVE'

We wish to bring to your immediate attention that on Hillman Minx Series IIIB Easidrive cars there is a possibility that a foul may occur under certain operating conditions between the throttle operating shaft lever and the choke cable, which could result in the throttle being retained in the partially open condition.


Dealers are requested to make up from 14 SWG (2 mm diameter) welding wire a retention clip for fitting in accordance with the attached drawing. (This should be painted black). These clips should be fitted to all Hillman Minx Series IIIB vehicles with Easidrive Transmission which have been delivered. Where cars are in the hands of owners, suitable action must be taken to call them in so that the described attention may be given without delay.

Suitable action is being taken on Production to deal with this condition. Details of chassis cut-off points will be sent to you in due course.

We will accept Warranty Claims for 1/2 hour per car which should be submitted to this office after this modification has been completed.

We are confident that we can rely upon your cooperation in dealing with this very important matter as expeditiously as possible.

ROOTES MOTORS INCORPORATED

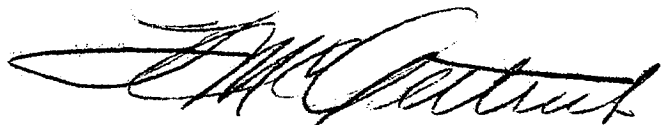

F. J. McGettrick
Manager
Wholesale Parts & Service Depts.

FJMcG:SO
encl.

SERVICE BULLETIN NO. 210

