

FUEL SYSTEM

No. C-2

PAGE I OF I

AUGUST, 1964

TO: ALL ROOTES GROUP DEALERS
MODEL: SUNBEAM IMP
SUBJECT: CARBURETOR AIR CLEANER FILTER

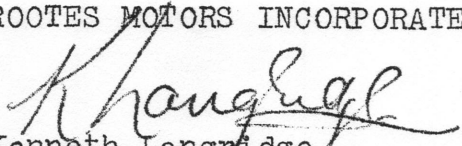
Complaints have been received of blocked air cleaner filters causing the engine to run rich and return high fuel consumption figures.

Investigation has shown that in every case an attempt had been made to clean the filter by washing in petrol or some similar solvent, and under no circumstances should this action be taken.

They must be replaced at the specified mileage intervals or more frequently in dusty or smog laden atmospheres.

This type of filter should be fitted dry.

ROOTES MOTORS INCORPORATED


Kenneth Langridge
General Service Manager

KL/jd